


CORNER RECORD

COUNTY OF PLACER T. 13N R. 11E Mt. Diablo MERIDIAN CALIFORNIA

CORNER TYPE: GOV'T. CORNER MEANDER RANCHO CONTROL OTHER

CORNER IDENTIFICATION — DATE OF VISIT June 9, 1992

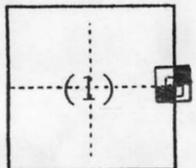

East 1/4 corner of Section 1, as shown on Record of Survey #1057, Recorded in Book-9 of Surveys at Page-126.


CORNER — LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER REBUILT

PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH

Monument set by LS 3850 as shown on RS 9-126 was destroyed by skid road construction and could not be found. The B. Oak bearing tree in the SW quadrant was also destroyed and its' location could not be identified closely enough to use for remonumentation. The 1/4 corner was reset at record bearing and distance from the CW1/16 corner of S6 with a check tie to both the SW1/16 of Section 6 and the remaining Pine bearing tree.

PHYSICAL DESCRIPTION OF MONUMENTS REBUILT OR PERPETUATED


Set a 2-1/2" alum. pipe with a 3-1/4" alum. cap. Pipe is 30" long with a flared base and magnet in the top. Built 20" dia. by 6" high stone mound around monument. Monument falls in cut bank on Eastern edge of new skid road about 3 feet below original grade.

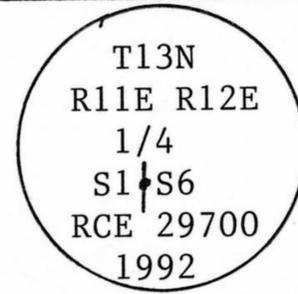

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST SECOND THIRD
 STATIONS USED: NGS (USC & GS) STATE COUNTY OTHER STATION _____ STATION _____
 ZONE _____ ELEVATION _____ NORTHINGS (Y) _____ EASTINGS (X) _____

(Fold)

SKETCH: (Include reference tie or witness points, remarks and topo of area)

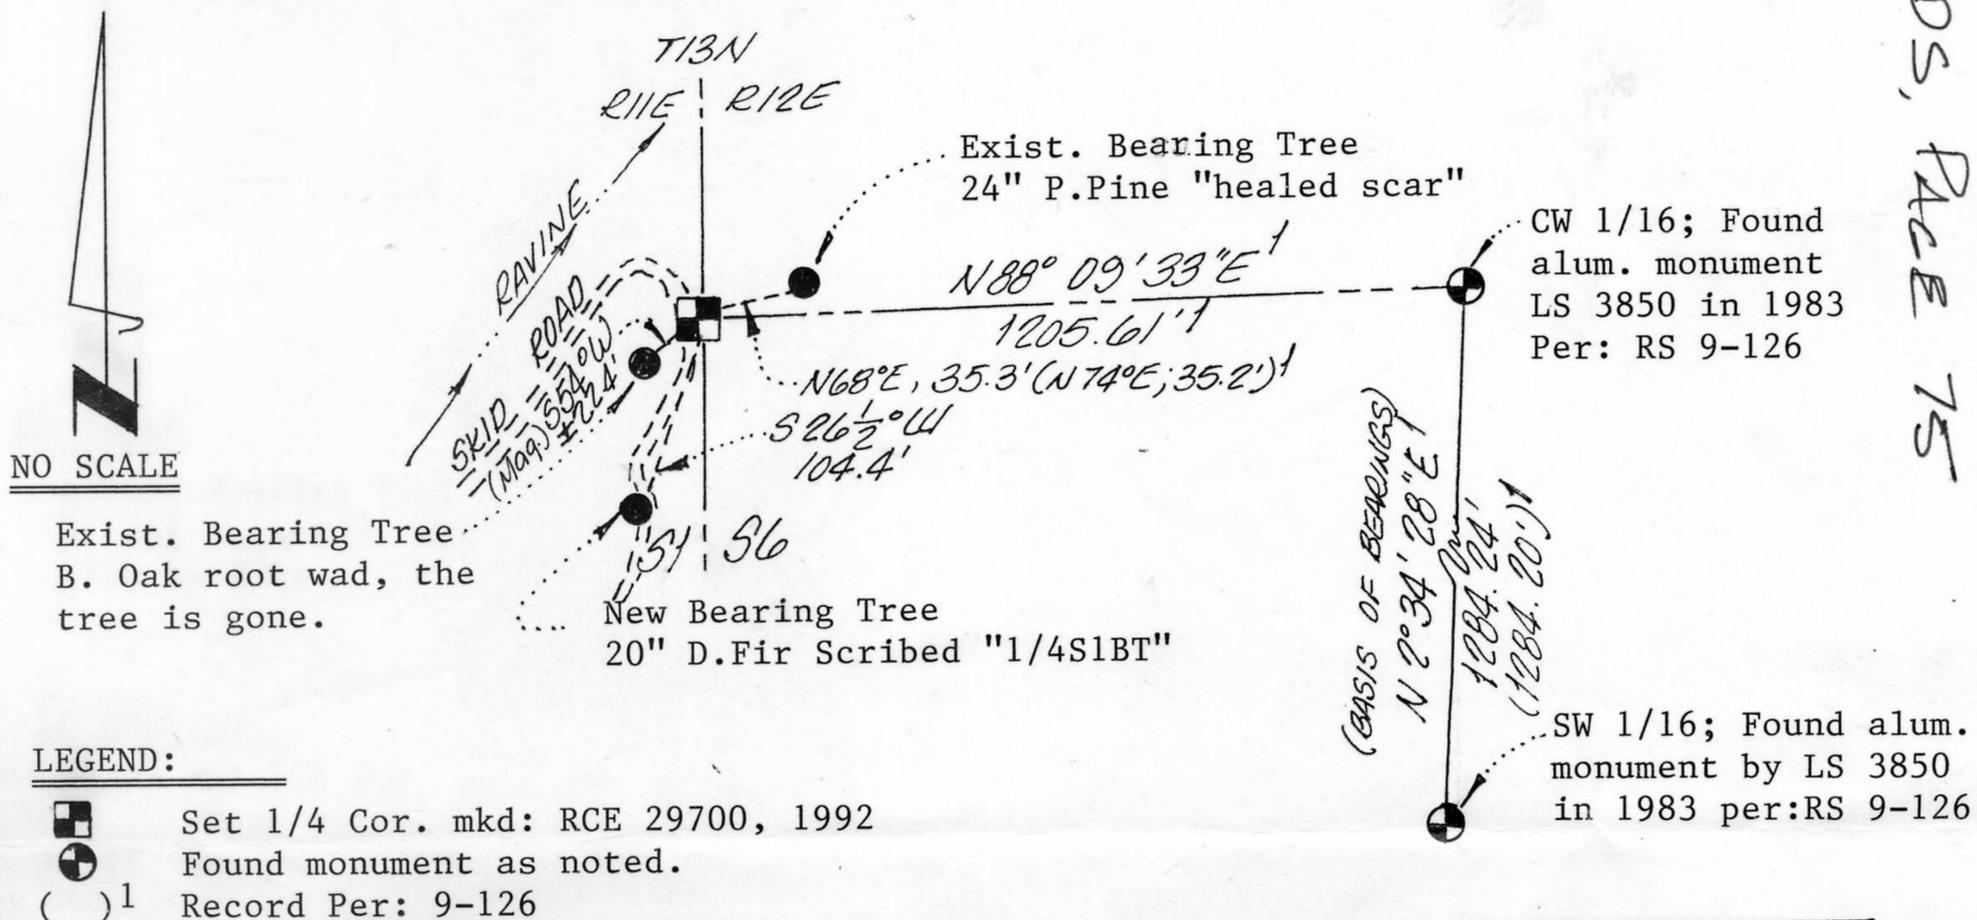

Book 3, CORNER RECORDS, PAGE 75

SURVEYOR'S CERTIFICATE

THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT ON June 10, 1992

SIGNED: [Signature]

L.S.—or R.C.E. No.: 29700

Expires 3-31-95



COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED 6/15 1992 AND EXAMINED AND FILED 7/22 1992

BY: Brian J. McDaniel

TITLE: DEPUTY COUNTY SURVEYOR

DOCUMENT No. _____

STATEMENT ON BACK OF SHEET

YES NO