


CORNER RECORD

Agency Index Bk 21 Pg 100
 Document Number 20170065

City of Foresthill County of Placer, California
 Brief Legal Description T14N R10E MDM, S25 - Cor. 7 of Florida Placer Mine, MS 2407

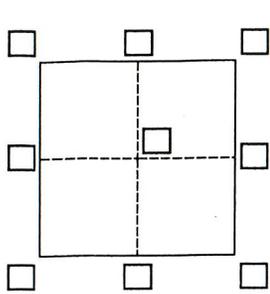

CORNER TYPE

Government Corner Control
 Meander Property
 Rancho Other
 Date of Survey September 8, 2016

COORDINATES (Optional)

N. _____ E. _____
 Elevation _____
 Units Metric U.S. Survey Foot
 Horizontal Datum _____
 Zone _____ Epoch Date _____
 Vertical Datum _____
 Complies with Public Resources Code §§8801-8819
 Complies with Public Resources Code §§8890-8902

PLS Act Ref.: 8765(d) 8771 8773 Other:

Corner/Monument: Left as found Established Rebuilt Pre-Construction
 Found and tagged Reestablished Referenced Post-Construction

Narrative of corner identified and monument as found, set, reset, replaced, or removed:

See sheet #2 for description(s):

corner also shown on E/Maps/62, ORPC

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with
 the Professional Land Surveyors' Act on July 10, 2019
 Signed Kass Kozloski P.L.S. or R.C.E. No. 8972



COUNTY SURVEYOR'S STATEMENT

This Corner Record was received July 10, 2019
 and examined and filed July 23, 2019
 Signed Benjamin J. Bardakian (P.L.S.) or R.C.E. No. 8373
 Title Deputy County Surveyor
 County Surveyor's Comment _____



Book 21 Corner Records Page 100

Book 21 CORNER RECORDS PAGE 100

Florida Placer Mine
Lot 87
MS 2407
Pvt.

Lot 2, E/Maps/62
Pvt.

Lot 1, E/Maps/62
Pvt.

Cor. 7 of Florida Placer Mine, MS 2407

Fd. 2 1/2" dia. iron pipe, 28" long, with BLM brass cap out of ground. Fd. glass shards 30" below ground [per BLM field notes] at record position relative to bearing tree and Forest Acres Sub'd monuments.

Re-Set BLM monument at location of glass shards. Re-placed shards at base of monument. Built 2'x2' rock collar around monument. Attached brass tag "LS 8972" to pipe.

S56°01'32"W 22.46'
[S53°45'00"W 22.67']

N4°22'31"E 113.76'
(N4°40'00"E 113.48')

N4°22'31"E 66.76'
(N4°40'00"E 66.50')
[N4°46'00"E 66.00']

Govt. Lot 11
USA

Auburn-Foresthill Rd.
G0088

Fd. 1" open pipe
(E/Maps/62)

Fd. 1" iron rod axle
(no record)

N88°32'00"W 31.73'
(N88°32'00"W 31.35')



- ⊙ Re-Set BLM monument.
- Found monument as described
- ⊙ 37" Douglas Fir bearing tree (heel blaze 100% overgrown)
- () record from Forest Acres, E/Maps/62 Official Records Placer Co.
- [] record from BLM Field Notes for Dependant Resurvey of Mineral Surveys in Secs. 25, 26, & 36, T. 14 N., R. 10 E. Filed as U-0518 in Placer Co. Surveyor's Office

LOCATION Forest Acres (E-62) Lot 1, 25387 Foresthill Rd.	
FILENAME ForesthillCemetery.TRV	SURVEY DATE 9-8-2016